

Tat's a fact

problem solving

CITBE044
CITROEN
BERLINGO
07-2004
4 cyl



Customer complaint

Interior ventilation fan not working correctly.

Problem summary

Interior ventilation fan running full speed when ignition on.

Diagnostic sequence

Interior fan unit mounted on passenger side under glove box. [1]

Interior fan has fan speed control amplifier mounted in fan housing [2] & [3]

To test the interior fan input from switch to amplifier, use a digital volt meter and back probe the thin pink wire going into the 4 pin connector. Voltage should vary with fan speed switch movement.

Fault description

The fan speed amplifier has an internal fault causing fan to run at full speed. The amplifier is available separately. Replacement of fan amplifier.

Fault solution

Replacement of fan amplifier.

A/C control unit Part No. 0000644178

Recommended time

Labour time was 2 hours, taking into account research time, location of parts and actual time spent fixing the problem. Add further time if fuel pump is being changed as well.

